Prüfinstitut Hoch

Lerchenweg 1 D-97650 Fladungen Tel.: int - 49 - 9778-7480-200 hoch.fladungen@t-online.de Fladungen

www.reaction-to-fire.de

Test laboratory for the fire behavior of building materials, Dipl.-Ing. (FH) Andreas Hoch Testing, supervising and certifying body, authorized by the building supervision authority

TEST REPORT PZ-Hoch-191203

for the proof of Fire behaviour according to DIN 4102, part 1 Translation of the German test report - no guarantee for translation of technical terms

company	DICKSON COATINGS
	415, avenue de Savoie
	F-38110 Saint Clair de la Tour
description of samples	polyester fabric coated with PVC and PVDF varnish on both sides colour: white
name of the material	"LAC 950 SLF"
sampling	by the company itself
content of request	Proof of flammability to classify building materials to class B1 "schwerentflammbar" according to DIN 4102, part 1
validity of test report	31.10.2024
result	The examined product meets in any colour the requirements of class B1 for "schwerentflammbare" (hardly flammable) building materials according to DIN 4102, part 1 (May 1998), suspended freely or with distance of >40 mm to same or other plain materials.

This test report includes 4 pages and 4 enclosures.

Remark: If the above mentioned building material is not used as product according to MBO § 2, Abs. 9. Ziffer1, there is no need for a general building supervisory test report.

This test report is not valid if the examined building material is used as product in the meaning of state building prescriptions (MBO § 17, Abs. 3).

This test report does not replace an eventually necessary proof of applicability concerning building supervisory or building laws in the meaning of state building prescriptions. This has to be verified by:

- "allgemeine bauaufsichtliche Zulassung" (general building inspectorate approval) or by "allgemeines bauaufsichtliches Prüfzeugnis" (general building inspectorate certificate) or by "Zustimmung im Einzelfall" (exceptional approval)
- This test report can underlie building supervisory procedures

for regular building products for the prescribed proofs of conformity

for non regular building products for the needed proofs of applicability.

This test report must not be published and copied without preceding agreement of the test laboratory and if agreed, only during validity and unchanged concerning appearance and contents.





1. Description of test material in condition as delivered

PN 30378: "LAC 950 SLF" colour: white

-polyester fabric coated with PVC and PVDF varnish on both sidesside A: matt characteristic values determined by the test laboratory:

area weight: about 985 g/m² thickness: about 0,78 mm

The testing laboratory is not provided with further details concerning composition of the tested building materials. Samples are deposited.

2. Preparation of samples

The samples were kept in climate chamber 23/50 until they reached constant weight.

- 3. Arrangement of samples mounting: freely suspended
 - #3042 flaming side A in warp direction
 - #3043 flaming side B in warp direction

#3044 flaming side A in weft direction

- 4. Date of test CW 47 in 2019
- 5. <u>Results</u> The test has been examined according to DIN 4102 (Mai 1998)

	Measurement	R	lesult with	n the teste	d specim	nen	Dim.
DO	Test number	#3042	#3043	#3044			
line	flamed direction flamed side	warp A	warp B	weft A	-		
1	Number of specimen arrangement acc. to. DIN 4102/T15, schedule 1	1	1	1			
2 3	<u>Maximum flame</u> height above bottom edge of the specimen Time ¹⁾	70 0:18	70 0:15	70 0:18			cm min:s
4	Burn through / melting Time ¹⁾	0:22	0:18	0:24			min:s
5 6	Observations on the back side of the specimen Flames / Glowing Time ¹⁾ Change of color Time ¹⁾	.I. .J. .J. .J.	.]. .]. .]. .].	J. J. J. J.	./. ./. ./.	J. J. J. J.	min:s min:s
7 8	Falling of burning droplets Start ¹⁾ Extent sporatic falling of burning droplets ²⁾	Л. Л. Л.	.1. .1. .1.	.1. .1. .1.	./. ./.	J. J.	min:s
9	continuous falling of burning droplets ²⁾	.1.	.1.	.1.	./. ./.	.1.	min:s
10	Falling of burning droplets Start ¹⁾	./.	Л.	.1.	.1.	.1.	min:s
11	Extent sporatic falling of burning droplets ²⁾	.1.	.1.	./.	./.	./.	
12	continuous falling of burning droplets ²⁾	.1.	<i>J.</i>	.1.	.1.	./.	

P06-04-FB05 eng Rev01



Lerchenweg 1 D-97650 Fladungen page 3 of 4 of the test report PZ-Hoch-191203

	Measurement	F	Result with	n the teste	d specim	nen	Dim.
no.	Test number	#3042	#3043	#3044			
line	flamed direction flamed side	warp A	warp B	weft A			
13	Afterflame time at the bottom of the sieve (max.)	.1.	.1.	.1.	.1.	.1.	min:s
14	Impairment of the burner by dropping or falling material: Time ¹⁾	.1.	.1.	.1.	.1.	.1.	min:s
15	Premature end of test Final occurance of burning at the specimen ¹⁾	.1.	Л.	Л.	.1.	./.	min:s
16	Time of eventually end of test 1)	.1.	.1.	./.	./.	.1.	min:s
17 18 19 20 21	Afterflame after end of test Time ¹⁾ Number of specimen Front side of specimen ²⁾ Back side of specimen ²⁾ flame length]. J. J. J.	.1. .1. .1. .1. .1.	.I. .J. .I. .J.	./. ./. ./. ./.	J. J. J. J. J.	min:s
22 23 24 25 26 27	Afterglow after end of test Time ¹⁾ Number of specimen <u>Place of appearance</u> Lower half of the specimen ²⁾ Upper half of the specimen ²⁾ Front side of specimen ²⁾ Back side of specimen ²⁾	J. J. J. J. J. J. J. J.	1. 1. 1. 1. 1. 1. 1. 1. 1.	.I. .I. .I. .I. .I. .I. .I.	.I. .I. .I. .I. .I. .I. .I.	J. J. J. J. J. J. J. J.	min:s
28 29 30	<u>Density of smoke</u> ≤ 400 % * min > 400 % * min ⁴⁾ Diagram: encl. no.	72 ./. 1	141 ./. 2	52 ./. 3	<u>./.</u>	 ./.	% * min % * min
31	Residual lengths: individual value ³⁾ Specimen 1 Specimen 2 Specimen 3 Specimen 4	47 51 53 48	55 52 48 54	56 56 56 53		-	cm cm cm cm
32	Average value, individual test 3)	50	52	55			
33	Photo of specimen in enclosure no.	1	2	3			
34 35	<u>Flue gas temperature</u> Maximum of average value Time ¹⁾	122 10:00	127 09:36	123 10:00			°C min:s
36	Diagram: encl. no.	1	2	3			

¹⁾ indication of times: from the begin of testing procedure

²⁾ checked off if applicable

³⁾ indication of carrier/foam layer separated in case of fire-proofing agents

4) very strong development of smoke



6. Explanations concerning the testing procedure

There were no additional tests proceeded because of the residual length of \geq than 45 cm.

7. Summary of results and additional establishments to Fire Behaviour

linen o.	measurement	Result with the tested specimen										
	test-no.	#3042	#3043	#3044			dime					
	flamed direction flamed side	warp A	warp B	weft A								
1	residual length	50	52	55			cm					
2	max. smoke temperature	122	127	123			°C					
3	density of smoke - integral	72	141	52			%min					
4	remarks: none					•						

According to DIN 4102, part 1, "schwerentflammbare" (hardly flammable) building materials must meet the requirements of class B2.

Pursuant to additional tests in the ignitability apparatus this can be determined (appendix 4).

8. Special remarks

- This report is only valid for the material as described under paragraph 1. In combination with
 other materials or with additional coatings or grounds etc. the burning behaviour may differ.
- This test report is not valid for the exposure to outdoor climate conditions.
- This test report is not valid, as soon as the fabric is used as a building product in the sense of the "Landesbauordnungen" (state building requirements, MBO § 17, par. 3).
- This test report is no substitute for a General Building Inspectorate Certificate.
- This test report is granted without prejudice to the rights of third parties, im particular private proprietary rights.
- For legal interests only the German original version is relevant.
- In General Building Inspectorates procedures this test report can be based for
 - o regular building materials for the required proof of accordance
 - o for not regular building materials for the required proof of applicability


9. Validity

This test report is valid until the mentioned date on page 1. The test report becomes invalid in case the standards on which the tests are based are changed.

SERNACHUNGS. Fladungen, 25.11.2019 clerk in charge: Head of the test laboratory: PRUF Fladunge (Dipl.-Ing.(FH) Jürgen Hammer) (Dipl.-Ing.(FH) Andreas Hoch)




Prüfinstitut Hoch Lerchenweg 1 D-97650 Fladungen

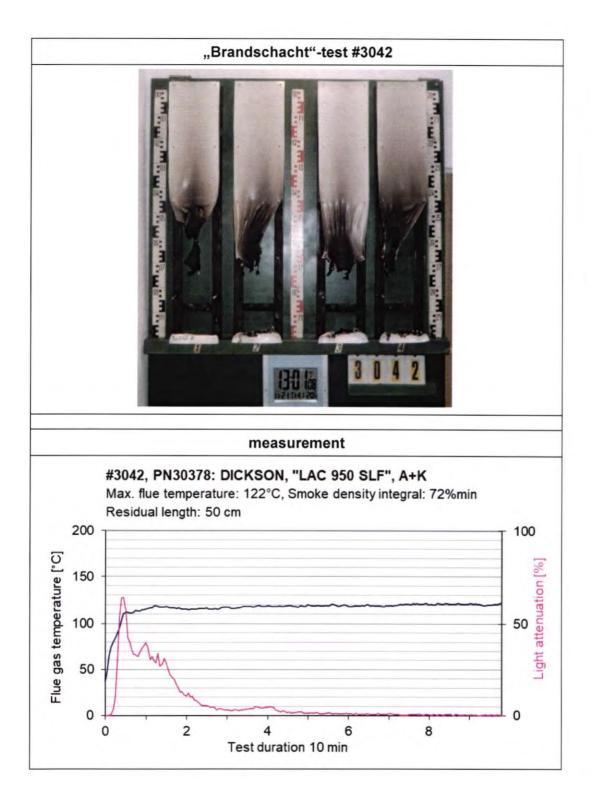




Prüfinstitut Hoch Lerchenweg 1 D-97650 Fladungen

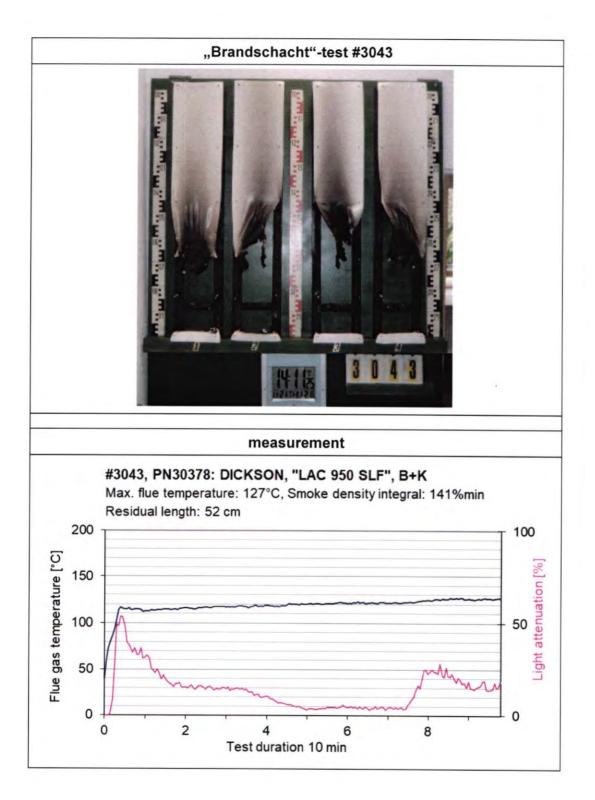



Prüfinstitut Hoch Lerchenweg 1 D-97650 Fladungen

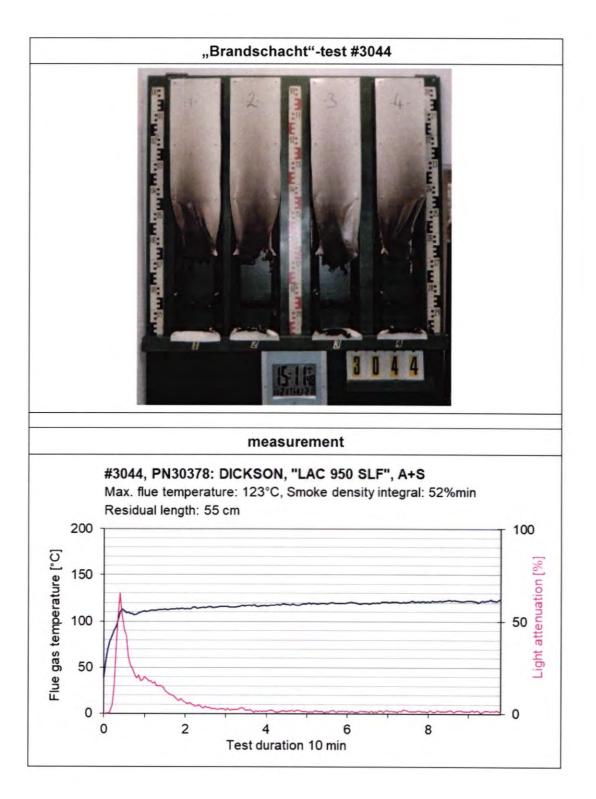



Test for normal flammability classifying B2 according to DIN 4102

- 1. Description of test material in condition as delivered look at page 2
- 2. Preparation of samples

Out of the material there have been cut samples for the ignitability apparatus. The samples were kept in a climate 23/50 until they reached constant weight.

3. Arrangement of samples -freely suspended-

Flaming in warp and in weft direction / side A and side B

- 4. Date of test CW 47 in 2019
- 5. Results

PN 30378: flaming side B in weft direction	edge-test							surface-test							
samples no.	1	2	3	4	5	6	1	2	3	4	5	6	- i		
ignition ¹⁾	1	1	1	1	1		4						s		
reaching the mark of measurement ¹⁾²⁾	.1.	./.	./.	.1.	.1.		./.						s		
max. flame height	10	10	10	10	10		6						cm		
time	15	15	15	15	15		15								
self cessation of the flames end of afterflame ¹⁾	16	16	16	16	16		15				-		s		
end of glowing ¹⁾	17	22	17	20	19		.1.	4					s		
flames were extinguished after ¹⁾	./.	./.	.1.	./.	./.		./.								
smoke development (visual)	moderate							moderate							
dropping of burning material during 20 s ¹⁾	.1.	.1.	.1.	./.	./.		-/-			-			s		

PN 30378: additional tests	edge-test							surface-test							
samples no.	1	2	3	4	5	6	1	2	3	4	5	6	Din		
ignition ¹⁾	1	1	1				4	4	4				s		
reaching the mark of measurement ¹⁾²⁾	./.	./.	./.				.1.	./.	.1.		-		s		
max. flame height	10	10	10				6	6	6				cm		
time	15	15	15				15	15	15	44					
self cessation of the flames end of afterflame ¹⁾	15	16	16			-	15	15	15				s		
end of glowing ¹⁾	16	17	17				./.	./.	.1.				s		
flames were extinguished after ¹⁾	./.	./.	./.				./.	.1.	.1.				s		
smoke development (visual)	moderate						moderate								
dropping of burning material during 20 s ¹⁾	.1.	-/-	-/-		220		-/-	-/-	-/-				s		

¹⁾ time mentioned from the beginning of the test²⁾ during 20 Sec -/- no appearance

ance -- no information

6. Remarks and explanations to the testing procedure - none -

7. Opinion concerning the dropping of burning material

The test for normal flammability shows no burning dripping material.